

[1] 安全に関する項目～ご使用前に必ずお読みください～

このたびは、電池式直流絶縁抵抗計をお買い上げいただき、誠にありがとうございます。ご使用前にはこの取扱説明書をよくお読みいただき、正しく安全にご使用ください。そして常にご覧いただけるように製品と一緒に大切に保管してください。

なお、取扱説明書での説明以外の使い方はせず、本器に与えられた保証が損なわれることがありますのでご注意ください。本文中の「△警告」および「△注意」の記載事項は、やけどや感電などの事故防止のため、必ずお守りください。

△ 安全に使用するための特に重要な事項を示します。
△ 高電圧が印加され危険なため触らないでください。
ACV：交流電圧 MAX600V：最大定格電圧は600V


1-2 安全使用のための警告文

- 以下の項目は、やけどや感電などの人身事故を防止するためのものです。本器をご使用する際には必ずお守りください。
1. 大電力または高電圧ラインでは使用しないこと。
2. AC 33 Vrms (46.7 V peak) または DC 70 V 以上の電圧は人体に危険です。
3. 絶縁抵抗測定時は被測定物の電源を切り離すこと。
4. 絶縁抵抗測定時は高電圧を発生するため感電に注意のこと。
5. 感電事故防止のため、絶縁抵抗測定後は必ず被測定物に充電された高電圧を放電すること。
6. 最大定格入力値(1.3 参照)を超える信号は入力しないこと。
7. 最大定格入力値を超える場合があるため、誘起電圧、サージ電圧の発生する(モータなど)ラインの電圧測定はしないこと。
8. 本体やテストリードに損傷がある場合は使用しないこと。
9. ケースや電池ふたをはずした状態では使用しないこと。
10. 感電防止のため測定用リードのつばより先を持たないこと。

[4] 機能説明


ファンクションスイッチ、MΩ(絶縁抵抗)測定スイッチ この2つのスイッチの切換えにより、次のようにファンクションやレンジが設定できます。

ファンクションスイッチの位置	MΩ測定スイッチ(*)	測定レンジ(ファンクション)
AC 600 V 1000 V/2000 MΩ 500 V/100 MΩ 250 V/100 MΩ 125 V/100 MΩ	PDM1529Sの場合 OFF PDM5219Sの場合 OFF	AC 600 V レンジ
AC 600 V 1000 V/2000 MΩ 500 V/100 MΩ 250 V/100 MΩ 125 V/100 MΩ	PDM1529Sの場合 ON PDM5219Sの場合 ON	1000 V/2000 MΩ レンジ 500 V/100 MΩ レンジ 250 V/100 MΩ レンジ 125 V/100 MΩ レンジ
DC 60 V BATTERY CHECK	OFF	DC 60 V レンジ
DC 60 V BATTERY CHECK	ON	BATTERY CHECK レンジ

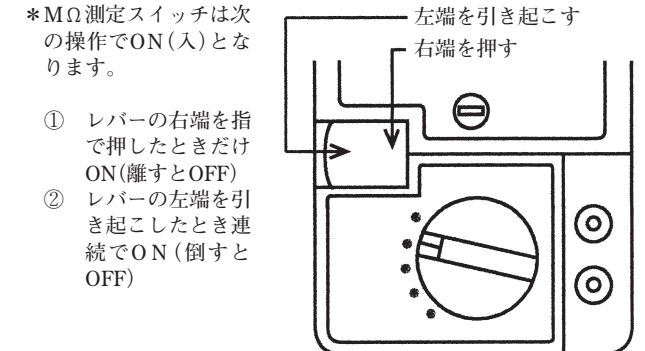

メータ零位調整器 ファンクションスイッチがOFFの位置のとき、メータの指針がMΩ目盛(スケール)の∞目盛線からはずれていたら、マイナスねじ回して直し合せてください。

- 7. 指示を読み取ります。ファンクションスイッチつまみの位置(設定レンジ)により専用の目盛を使用します。(PDM5219Sは全レンジ共通の目盛です。)
8. MΩ測定スイッチをOFFにします。
9. 被測定物に充電された高電圧を放電させます。(5-4項を参照)

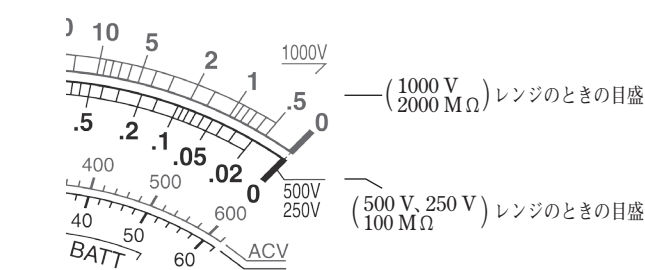

- 10. まず被測定物からテストピン付きリードのテストピンを離し、次にクリップ付きリードのクリップをはずします。
11. ファンクションスイッチつまみを必ずOFF位置にします。

5-4 ディスチャージ(放電)機能について

- 安全のためにディスチャージが必要理由は絶縁抵抗測定後にコンデンサや電線などの容量性の被測定物に残る高電圧を放電させ事故を防ぎます。
2. ディスチャージの方法 前項(5-3 4)の⑧に続いて行います。
① MΩ測定終了後、テストピンおよびクリップは被測定物に接続したままで、MΩ測定スイッチのみをOFFにします。
② このときメータの指針は右方向に振れ、その振れは時間とともに小さくなります。(充電されていた電荷が放電していることを示す)
③ 指示が零(MΩ目盛の∞)となり、ディスチャージ(放電)が完了したら、前項(5-3 4)の⑩の操作を行います。

7-4 電池交換

- 1. 測定端子に入力を加えた状態でリヤケースや電池ふたをはずすと、感電のおそれがあります。
2. 高電圧の発生防止のため、MΩ測定スイッチおよびファンクションスイッチつまみをOFFの位置にしてから電池交換すること。



△電池は必ず6LF22/6LR61(9V形アルカリ電池)をご使用ください。

[8] アフターサービスについて

- 8-1 保証期間について 本製品の品質保証期間は、お買い上げの日より3年間です。ただし、日本国内で購入し日本国内でご利用いただく場合に限りです。また、製品本体の許容差は1年保証、製品付属の電池、テストリード等は保証対象外とさせていただきます。
8-2 修理およびお問い合わせについて 1. 修理依頼の前に次の項目をご確認ください。
・電池の容量はありますか？電池極性の極性は正しいですか？
・測定用リードは断線していませんか？
2. 保証期間中の修理
・保証書の記載内容によって修理させていただきます。
3. 保証期間経過後の修理
・修理によって本来の機能が維持できる場合、ご要望により有料で修理させていただきます。
・修理費用や輸送費用が製品価格より高くなる場合もありますので事前にお問い合わせください。
・本品の補修用性能部品の最低保証期間は、製造打切後6年間です。補修用性能部品保有期間を修理可能期間とさせていただきます。購買部品の入手が製造会社の製造中止等により不可能になった場

- 11. 測定中は他のファンクションに切り換えないこと。
12. 本器または手が水などでぬれた状態では使用しないこと。
13. 指定タイプのテストリードを使用すること。
14. テストリードは被測定物の接地側へ先に接続し、はずす場合はライン側を先にはずしてから接地側をはずすこと。
15. 電池交換を除く修理・改造は行わないこと。
16. 始業点検および年1回以上の点検は必ず行うこと。
17. 屋内で使用すること。
18. 腐食性ガスや爆発性ガスが発生する場所では使用しないでください。

△ 注意

- 1. 絶縁抵抗測定時、本器の測定端子には高電圧が発生しています。耐電圧が、低かったり不明の機器及び部品(半導体などの)接続されている回路(回路)では、破損防止上それ等を回路より外して測定することをお奨めます。特にコンピュータは要注意です。
2. 絶縁抵抗測定では、被測定回路の使用電圧になるべく近い定格測定電圧の絶縁抵抗計で測定してください。
例 100 Vの回路では定格測定電圧125Vの絶縁抵抗計を用いる。
3. 強力な電磁界、静電界のある場所での測定、インバータなど高周波を多量に含む回路の測定では誤動作することがあります。

1-3 最大過負荷保護入力値(AC電圧はサイン波の実効値で規定)

ファンクション	最大定格入力値	最大過負荷保護入力値
ACV	AC 600 V	AC 720 V
DCV	DC 60 V	DC 120 V
MΩ, BATTERY CHECK	△電圧・入力禁止	


[2] 用途と特長

- 2-1 用途
・本器は低電圧電線路や機器の絶縁抵抗測定用直流絶縁抵抗計です。
2-2 特長
・目盛を最小限にし、見やすさ・読みやすさを改善した3レンジ式
・JIS C1302で規定された定格電流で低い絶縁抵抗値まで測定電圧を維持します。

[5] 測定方法

- 5-1 始業点検
△ 警告
1. 破損のある本体やテストリードを使用するの測定はしないこと。
2. テストリードが断線していないことを確認すること。
3. テストリードの断線テスト中、測定端子には高電圧が発生しているため、感電に注意すること。
4. 感電、電池消耗防止上、測定終了後はMΩスイッチ・レバーおよび、ファンクションスイッチつまみを必ずOFF位置にすること。


測定の前に「[外観][指針0位置]」*「[電池残量][測定用リード]」の順で点検を行います。(※指針0位置とは、DC 60 V目盛の0目盛位置またはMΩ目盛の∞目盛位置)

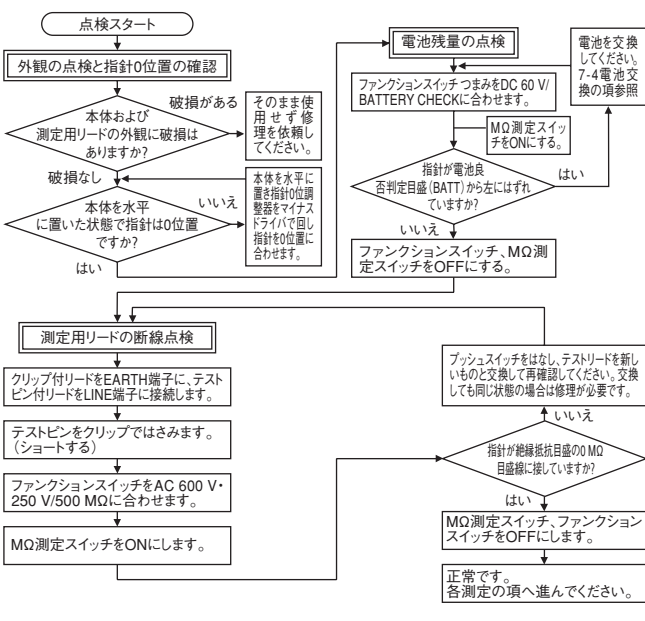

5-5 ACV(交流電圧)の測定(測定レンジはAC 600 Vレンジのみ)


- △ 警告
1. 最大定格入力値AC 600 Vを超えた電圧を加えないこと。
2. 測定中はファンクションスイッチつまみを切り換えないこと。
3. MΩ測定スイッチを押したり、引き起こした状態では電圧測定をしないこと。
4. プレーカ付きの被測定回路では、その2次側(負荷側)で電圧の測定をすること。
5. 感電防止のためテストリードのボンブラグや、クリップの金属部に手を触れないこと。

△ 注意
正弦波以外の波形や、50～60 Hz以外の周波数の交流では指示誤差を生じます。

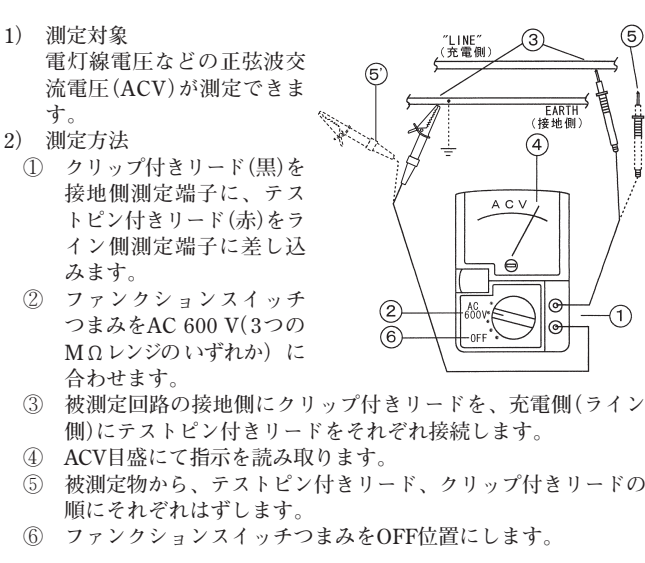

7-4 電池交換

- 1. 測定端子に入力を加えた状態でリヤケースや電池ふたをはずすと、感電のおそれがあります。
2. 高電圧の発生防止のため、MΩ測定スイッチおよびファンクションスイッチつまみをOFFの位置にしてから電池交換すること。

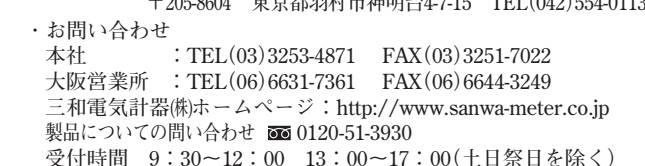

△電池は必ず6LF22/6LR61(9V形アルカリ電池)をご使用ください。

[9] 仕様

 
- 9-1 一般仕様
AC整流方式 : 半波整流方式(平均値指示実効値換算)
メータ仕様 : 内蔵型トードバンド方式、48 μA
電池消耗表示 : BATTERY CHECKレンジにて確認
許容差保証温度範囲 : 23±5℃ 75%RH以下 結露のないこと
使用温度湿度範囲 : 0～43℃ 80%RH以下 結露のないこと
使用湿度温度範囲 : -10～50℃ 70%RH以下 結露のないこと
保存環境条件 : 高度2000 m以下 環境汚染度 II
電源 : 6LF22/6LR61 (9V形アルカリ電池) 9Vx1
※出荷時の電池について
工場出荷時にモニター用電池が組み込まれておりますので、記載された電池寿命に満たないうちに切れることがあります。
モニター用電池とは製品の機能や性能をチェックするための電池のことです。
最大消費電力 : 約2.6 W(1000 V/2000 MΩレンジのとき)
測定可能回数 : 500回(1回の測定時間を、5秒間 ON/25秒間 OFF(電池寿命) とし、定格電流を流す値の抵抗器を接続、定格電圧を維持できる測定回数)
IP保護等級 : IP20
EMC : IEC61326
安全規格 : IEC61010-1, IEC61010-2-030 CAT. III 600 V * IEC61010-2-033, IEC61010-031



PDM1529S/PDM5219S 絶縁抵抗計

取扱説明書 INSTRUCTION MANUAL

三和電気計器株式会社
本社=東京都千代田区外神田2-4-4 電波ビル
郵便番号=101-0021 電話=東京 (03)3253-4871
大阪営業所=大阪市浪速区恵美須西2-7-2
郵便番号=556-0003 電話=大阪 (06)6631-7361
SANWA ELECTRIC INSTRUMENT CO., LTD.
Dempa Bldg., 4-4 Sotokanda2-Chome, Chiyoda-ku, Tokyo, Japan



5-2 電池残量の点検(BATTERY CHECK)

MΩ(絶縁抵抗)測定の前には、電池残量の点検(前項5.1参照)を必ず行ってください。電池が消耗しているや測定誤差の原因となるだけでなく、誤測定により危険です。点検方法は5-1 始業点検を参照してください。(電池は必ず6LF22/6LR61(9V形アルカリ電池)をご使用ください)

△ 電池残量の点検は5秒以上続けなさい。

- 5-3 MΩ(絶縁抵抗)の測定
△ 警告
1. MΩ測定レンジのとき、測定端子には電圧を絶対に加えないこと。
2. 被測定物(回路)の電源を切り離してから測定すること。
3. 被測定回路に電圧が加わっていないことを、AC 600 Vレンジなどで確認してから測定をすること。
4. 測定中は本器から高電圧を発生するため、テストピンやクリップ、および被測定物には手を触れないこと。
5. 測定後は、本器および被測定回路が高電圧で充電されているので感電に注意すること。
6. 感電事故のおそれがあるため、測定後は必ず被測定物に充電された高電圧を放電すること。[5-4 ディスチャージ]の項参照

- △ 注意
1. 被測定物が接地(アース)されているときは、通常接地側にクリップ付きリード(EARTH)を、回路側へテストピン付きリード(LINE)を接続します。(このように接続した方が、逆に接続した場合より一般に小さな値となる)
2. 測定誤差を防止するため、LINE側に接続したテストリードは、被測定物や大地になるべく触れないようにして測定します。
3. 絶縁抵抗は、温度や湿度によって大きく変化します。印加する電圧(測定電圧)によっても変化します。一般に温度、湿度、電圧がそれぞれ高い程、絶縁抵抗値は低くなります。

- △ 参考
1. 本器の定格電流は1 mA (1 mA～1.2 mA)です。(定格測定電圧/1 mA以下の抵抗で、かつ第1有効測定目盛内の値の抵抗を測定したとき1 mA～1.2 mA以内)
2. 無負荷電圧は定格測定電圧の1.25倍以内です。
3. 測定の際、発振音が開こえても故障ではありません。

5-6 DCV(直流電圧)の測定(測定レンジはDC 60 Vレンジのみ)

- △ 警告
1. 最大定格入力値DC 60 Vを超えた電圧を加えないこと。
2. その他、前項(5-5)の警告と同様の注意をすること。

1) 測定対象

バッテリーなどの直流電圧の測定ができます。また、MΩ測定前に被測定回路の直流電圧の有無のチェックにも使えます。

2) 測定方法

- ① クリップ付きリード(黒)を接地側測定端子に、テストピン付きリード(赤)をライン側測定端子に差し込みます。
② ファンクションスイッチつまみをDC 60 V/BATTERY CHECKに合わせます。
③ 被測定物(回路)の一端にクリップ付きリード(黒)を、+側にテストピン付きリード(赤)をそれぞれ接続します。
④ DCV目盛にて指示を読み取ります。
⑤ 被測定物から、テストピン付きリード、クリップ付きリードの順にそれぞれはずします。
⑥ ファンクションスイッチつまみをOFF位置にします。





9-2 測定範囲および許容差

許容差保証範囲: 23±5℃ 75%RH以下 結露のないこと
姿勢: 水平±5°、外部磁界: なし、電池電圧: 電池有効範囲内

機種名	PDM1529S	PDM5219S	
絶縁抵抗(MΩ)	定格測定電圧	500 V	
	最大目盛値	100 MΩ	
	第1有効目盛値	0.02～0.1～50	
	第2有効目盛値	100 MΩ	
	無負荷電圧	0.02～0.1～50	
	短絡電流	2.9 mA以下	
交流電圧(ACV)	0～600 V	0～60 V	
	最大目盛値の±5%以内(正弦波交流: 50～60 Hz)		
直流電圧(DCV)	0～600 V	0～60 V	最大目盛値の±5%以内
	最大目盛値の±5%以内		
動作不確かさ	±30%以内 (IEC規格で許容される最大値)		
	変動の影響要素「E1:姿勢、E2:供給電圧、E3:温度」		

[3] 各部の名称

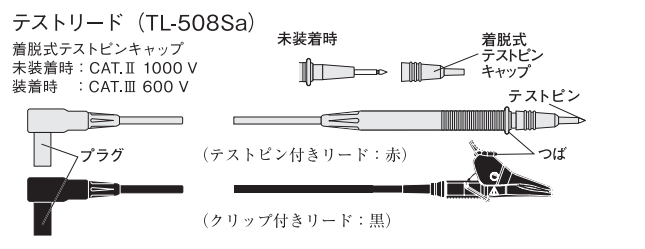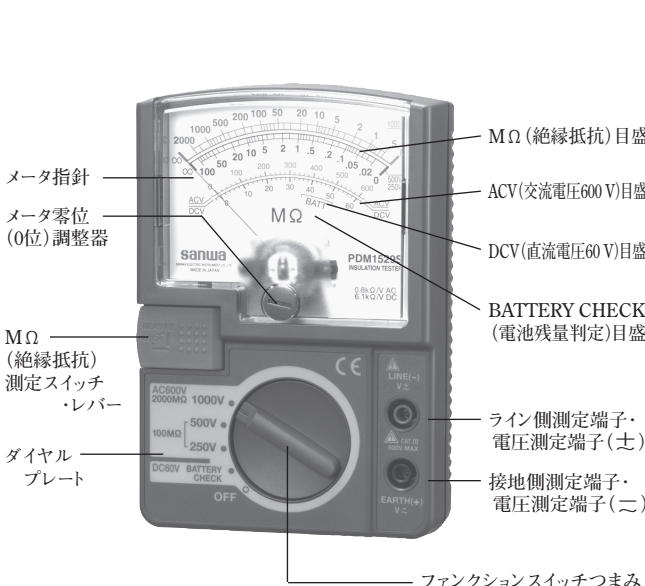

本書に掲載した製品の仕様や外観は改良等の理由により、予告なしに変更することがありますのでご了承ください。

- 1) 測定対象
電気機器や回路の絶縁抵抗(MΩ)測定
定格測定電圧
2) 測定方法

機種名	定格測定電圧
PDM1529S	250 V, 500 V, 1000 V
PDM5219S	125 V, 250 V, 500 V

- 3) 測定レンジの選択
絶縁抵抗の測定では、特にレンジのない限り、被測定回路の使用電圧になるべく近い電圧のレンジを選びます。
例えば、100 Vの家電製品や屋内配線の絶縁抵抗測定では、125 Vの定格測定電圧のレンジを、200 Vの動力回路の測定では、250 Vの定格測定電圧のレンジを選びます。
4) 測定方法
① 被測定物の電源を切ります。
② クリップ付きリード(黒)を接地側測定端子(EARTH)へ、テストピン付きリード(赤)をライン側(LINE)測定端子に差し込みます。
③ ファンクションスイッチつまみを目的の定格測定電圧のレンジに合わせます。
④ 被測定物にクリップ付きリードのクリップを接続します。通常は接地側測定端子を接地側に接続します。
⑤ 被測定物のもう一方にテストピン付きリードのテストピンを接触させます。
△注: この状態(MΩ測定スイッチOFF)でメータが振れる場合は、被測定物が活線状態です。(電圧が加わっている)必ず、電圧がない状態にしてから測定してください。
⑥ MΩ測定スイッチをON(入)にします。[「4」機能説明]の項を参照)

[6] 携帯ケースの使い方

- 測定時には、図のようにケースに収納し、首に掛けてご使用ください。
・ふたは(へ)方向にA点を支点に回して開きます。
・要らぬ底面に落ち、ホックで結合。
・首掛けで使用する時は、手掛で携帯するとき、フックで結合。

[7] 保守管理について

- △ 警告
1. 安全上重要項目です。説明書をよく理解して管理を行うこと。
2. 安全と確度の維持のため1年に1回以上は校正・点検を実施すること。


- 7-1 保守点検 (5-1 始業点検を参照してください)
1) 本体の外観: 落下などにより、外観が壊れていないか?
2) 測定用リード: コード部分が傷んでいないか?
・芯線などの導電部分が露出していないか?

以上に該当する場合は使用を中止し、修理または新しいものと交換してください。

- 7-2 校正: 詳細については、三和電気計器・羽村工場サービス課までお問い合わせください。項目8-2参照

7-3 保管について

- △ 注意
1. パネル、ケースなどは揮発性溶剤に弱い。シンナーやアルコールなどで拭かないこと。乾らぬ布などで軽く拭き取る。
2. パネル、ケースなどは熱に弱い。熱を発するもの(はんだこてなど)の近くに置かないこと。
3. 振動の多い所や落下のおそれがある所には保管しないこと。
4. 直射日光下や高温または低温、多湿、結露のある場所では保管しないこと。(9-1項の保存温度湿度範囲参照)
5. 長期使用しない場合は電池を必ず抜くこと。

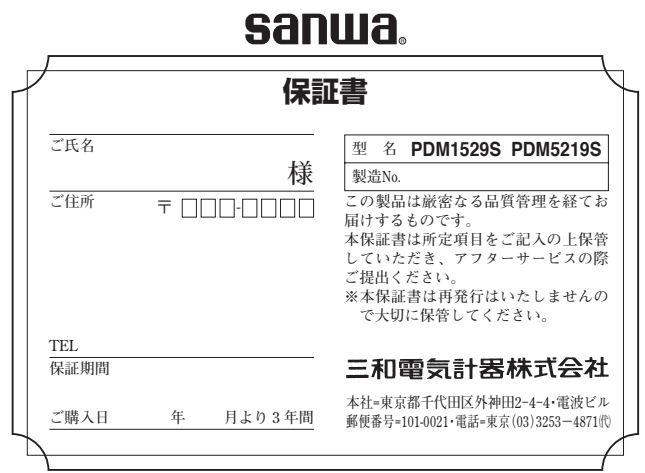

保証規定
保証期間中に正常な使用状態のもとで、万一故障が発生した場合は無償で修理いたします。ただし下記事項に該当する場合は無償修理の対象から除外いたします。
1. 取扱説明書と異なる不適当な取扱いまたは故障
2. 当社サービスマン以外による不当な修理や改造に起因する故障
3. 火災水害などの天災を始め故障の原因が本装置以外の事由による故障
4. 電池の消耗による不動作
5. お買上げ後の輸送、移動、落下などによる故障および損傷
6. 本保証書は日本国内において有効です。
This warranty is valid only within Japan.
年 月 日 修理内容をご記入ください。

PDM1529S/PDM5219S INSULATION RESISTANCE TESTER

INSTRUCTION MANUAL

SANWA ELECTRIC INSTRUMENT CO., LTD.

Dempa Bldg., 4-4 Sotokanda 2-Chome
Chiyoda-ku, Tokyo, Japan



[1] Read First: Safety Information

We thank you for your purchasing our product, the battery-driven insulation resistance tester.

This is a DC resistance tester developed under the principle to provide new and unique design and function for the measurement of insulation resistance of each kind of electric equipments. Since this tester generates high voltage, we recommend that you read this instruction manual thoroughly, and treat the tester correctly and safely.

The symbols used on this tester and in this instruction manual denote the following meanings:

- ⚠ Be careful as the high voltage is impressed.
- ⚠ Be careful because there is a possibility of bodily injury or the destruction of equipment.

⚠ WARNING

To ensure that the meter is used safely, follow all safety and operating instructions.

1. Never use tester for high power or high voltage circuit.
2. Pay special attention when measuring the voltage of AC 33 Vrms (46.7 V Peak) or DC 70 V or more to avoid injury.
3. Disconnect power source of the measured circuit before measuring insulation resistance.
4. High voltage is generated while measuring insulation resistance. Be cautions of electric shock.
5. After measuring insulation to avoid electric shock. Be sure to discharge the high voltage charged.
6. Never apply an input signal exceeding the maximum rating input value.
7. Never use tester for measuring the line connected with equipment (i.e. motors) that generates induced or surge voltage since it may exceed the maximum allowable voltage.
8. Never use tester if the tester or test leads are damaged or broken.
9. Never use uncased tester.
10. Always keep your fingers behind the finger guards on the probe when making measurements.

- 1 -

- For storing the instrument, avoid hot, cold or humid places or places under direct sunlight or where condensation is anticipated. (See 9.1 Storage temperature/humidity)
- Be sure to remove the battery when the instrument is not to be used for a long period.


[5] Description of Functions

- Function control knob and MΩ (insulation resistance) measuring switch by operating these two switches, the functions and ranges can be set as shown below.

Position of Function Control Knob	MΩ Measuring Switch (*)	Set Range (Function)
AC 600 V	1000 V/2000 MΩ	600 VAC range
	500 V/100 MΩ	
	250 V/100 MΩ	
AC 600 V	1000 V/2000 MΩ	1000 V/2000 MΩ range
	500 V/100 MΩ	500 V/100 MΩ range
	250 V/100 MΩ	250 V/100 MΩ range
DC 60 V • BATTERY CHECK	OFF	DC 60 V range
	ON	BATTERY CHECK range

- * The MΩ measuring switch is turned on by the following operation.

- ① ON only when the right end of the lever is pressed with a finger. (OFF when the finger is released)
- ② Continuously ON when the left end of the lever is raised. (OFF when it is laid down)

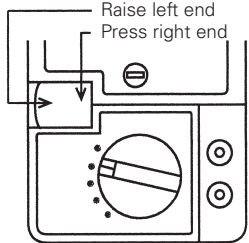

- Meter zero position adjustment
If the meter pointer is not on the ∞ graduation line of the MΩ scale when the function control knob is at OFF, adjust the zero position with a screwdriver.

- 4 -

⚠ REFERENCE

1. The rated current of this tester is 1 mA. (1 mA to 1.2 mA when the resistance of a value below the rated measuring voltage/1 mA and within 1st effective measurement scale is measured.)
2. The no-load voltage is within 1.25 times the rated measuring voltage.
3. While measuring there may be an oscillator noise from the meter, but this is not a malfunction.

- 1) Measuring object
Measurement of insulation resistance (MΩ) of electric equipment and circuits.
- 2) Rated measuring voltage

Model	Rated measuring voltage
PDM1529S	250 V/500 V/1000 V
PDM5219S	125 V/250 V/500 V

- 3) Selection of a measuring range
When measuring insulation resistance, select a range of the voltage that is close to the voltage used by the circuit to measure, unless otherwise specified.

For example, when measuring insulation resistance of 100 V home appliances and indoor wiring, select the 125 V rated measuring voltage range and when measuring 200 V power circuits, select the 250 V rated measuring voltage range.


- 4) Measuring method
 - ① Power off the measuring object.
 - ② Connect the lead with clip (black) to the earth side measuring terminal (EARTH) and the lead with test pin (red) to the line side measuring terminal (LINE).
 - ③ Turn the function control knob to a desired rated measuring voltage range.
 - ④ Connect the clip of the lead with clip to the measuring object. Normally, the earth side measuring terminal should be on the earth line side.

- 8 -

- ③ Connect the lead with clip (black) to the negative (-) side of the measuring object (circuit) and the lead with test pin (red) to the positive (+) side.
- ④ Read the indicated value on the DCV scale.
- ⑤ Disconnect the lead with test pin and the lead with clip in this order from the measuring object.
- ⑥ Turn the function control knob to the position of OFF.

[7] Battery Replacement

- ① Remove two battery lid securing screws.
 - ② Replace the consumed battery that is connected to the snap terminal with a new one.
 - ③ Set the battery in the original place and secure the battery lid with screws.
- ⚠ Be sure to turn the function control knob to the position of OFF prior to replacing the battery.
- ⚠ Be sure to use the alkaline battery 6LR61 (6LF22)x1(9 V)

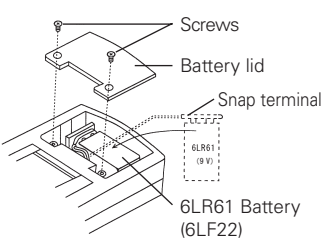

[8] After-Sales Service

8.1 Warranty and Provision

Sanwa offers comprehensive warranty services to its end-users and to its product resellers. Under Sanwa's general warranty policy, each instrument is warranted to be free from defects in workmanship or material under normal use for the period of one (1) year from the date of purchase.

This warranty policy is valid within the country of purchase only, and applied only to the product purchased from Sanwa authorized agent or distributor.

Sanwa reserves the right to inspect all warranty claims to determine the extent to which the warranty policy shall apply. This warranty shall not apply to test leads, disposables batteries, or any product or parts, which have been subject to one of the following causes:


1. A failure due to improper handling or use that deviates from the instruction manual.

- 12 -

How To Use Carrying Case

During measurement, set the case as illustrated and hang it from the neck.

- Lid turns in direction at pivot the A.
- Lay it along the bottom of the box and secure it by hooks marked by*

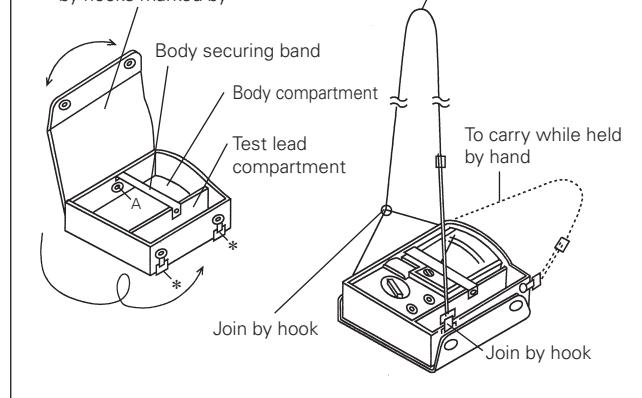

[6] Measuring Method

6.1 Start-up Check

⚠ WARNING


1. Do not use a damaged tester or test lead.
2. Make sure test lead wiring is not broken.
3. When testing the continuity of a test lead, the measuring terminals are under a high voltage. Be careful of electric shock.
4. To prevent electric shock and battery consumption, be sure to turn the MΩ measuring switch and function control knob to OFF after measurement.

- 5 -


- ⑤ Bring the test pin of the lead with test pin in contact with the other side of the measuring object.

⚠ CAUTION : If the meter deflects in this state, the measuring object is charged. Be sure to remove the voltage prior to measurement.

- ⑥ Turn on the MΩ measuring switch. (See [5] Description of Functions)
- ⑦ Read the indicated value. Use the appropriate scale according to the position of the function control knob (set range). (See the following fig.)

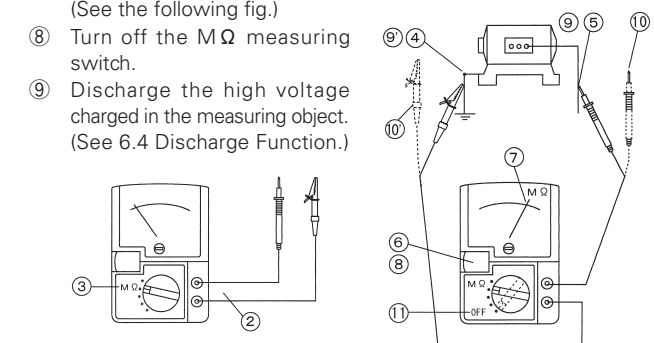

- ⑧ Turn off the MΩ measuring switch.
- ⑨ Discharge the high voltage charged in the measuring object. (See 6.4 Discharge Function.)

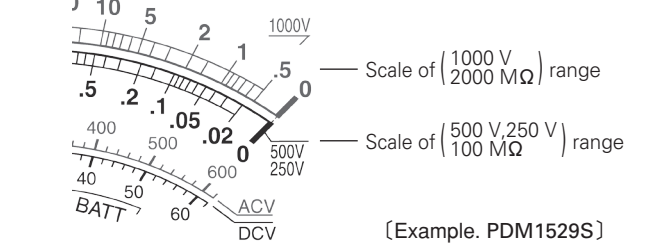

(PDM5219S is a scale common to all ranges.)

- 9 -

2. A failure due to inadequate repair or modification by people other than Sanwa service personnel.
3. A failure due to causes not attributable to this product such as fire, flood and other natural disaster.
4. Non-operation due to a discharged battery.
5. A failure or damage due to transportation, relocation or dropping after the purchase.

8.2 Repair

Customers are asked to provide the following information when requesting services:

1. Customer name, address, and contact information
2. Description of problem
3. Description of product configuration
4. Model Number
5. Product Serial Number
6. Proof of Date-of-Purchase
7. Where you purchased the product

- 1) Prior to requesting repair, please check the following:
Capacity of the battery, polarity of installation and discontinuity of the test leads.

- 2) Repair during the warranty period:
The failed meter will be repaired in accordance with the conditions stipulated in 8-1 Warranty and Provision.

- 3) Repair after the warranty period has expired:
In some cases, repair and transportation cost may become higher than the price of the product. Please contact Sanwa authorized agent / service provider in advance.

The minimum retention period of service functional parts is 6 years after the discontinuation of manufacture. This retention period is the repair warranty period. Please note, however, if such functional parts become unavailable for reasons of discontinuation of manufacture, etc., the retention period may become shorter accordingly.

- 4) Precautions when sending the product to be repaired
To ensure the safety of the product during transportation, place the product in a box that is larger than the product 5 times or more in volume and fill cushion materials fully and then clearly mark "Repair Product Enclosed" on the box surface. The cost of sending and returning the product shall be borne by the customer.

8.3 SANWA web site

http://www.sanwa-meter.co.jp
E-mail: exp_sales@sanwa-meter.co.jp

- 13 -

11. Be sure to disconnect the test pin from the circuit when changing the function.
12. Never use tester with wet hands or in a damp environment.
13. Never use test leads other than the exclusive test leads.
14. Never open tester case except when replacing batteries.
15. Do not attempt any alterations of original specifications.
16. To ensure safety and maintain accuracy, calibrate and check the tester at least once a year.
17. Indoor use.
18. Do not use the instrument in a place where corrosive or explosive gas is produced.

⚠ CAUTION

Remove components such as semi-conductors and apparatuses from the circuit of measuring object to avoid damages when withstand of the object is unknown or lower than rated measuring voltage of a resistance insulation tester, especially in case of the objects you measure connected with PCs or computers.

Maximum Overload Protection Input

Function (Range)	Maximum rating input value	Maximum overload protection input
ACV (600)	AC 600 V	AC 720 V
DCV (60)	DC 60 V	AC 600 V

[2] Applications and Features


- 2.1 Applications
 - DC insulation resistance tester to measure the insulation resistance of electric lines and electric equipment.

2.2 Features

- This tester has the minimum number of scale graduations and employs a three-range system for easy viewing and readability.
- The measured voltage is maintained until the low insulation resistance value at the rated current specified in IEC61557-2.

- 2 -

Before starting wiring measurement, check the "appearance", "pointer 0 position" (*), "battery" and "measuring lead" in this order. (*The pointer 0 position is the 0 position of the DC 60 V scale or ∞ position of the MΩ scales.)

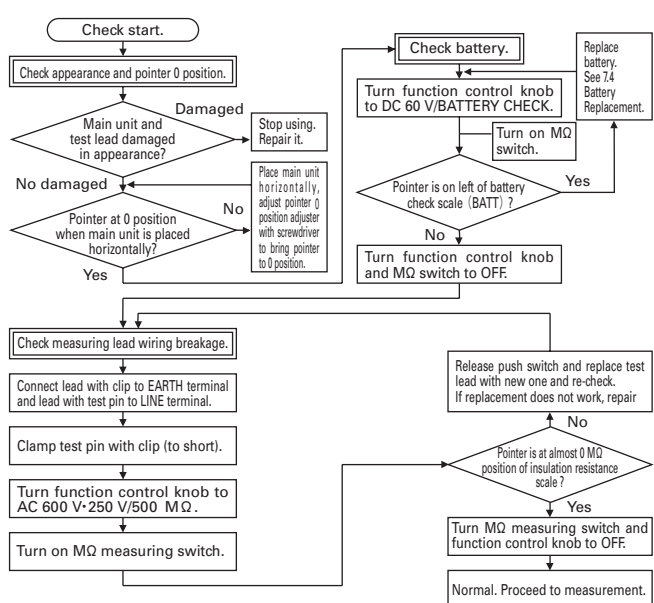

6.2 How to Check the Battery (BATTERY CHECK)

Prior to MΩ (insulation resistance) measurement, be sure to check the battery. A consumed battery will cause not only measurement errors but danger due to erroneous measurement.

For checking methods, refer to 6.1 Start-up Check.

⚠ Do not check the battery for more than 5 seconds.

- 6 -

6.4 Discharge Function

- 1) Reason of a need to discharge
For safety, high voltage remaining in capacitive measuring objects such as capacitors and electric wire must be discharged to prevent accidents.

- 2) Discharging method
This procedure follows the step ⑧ of 6.3-4)

- ① When the MΩ measurement has been completed, turn off only the MΩ measuring switch with the test pin and the clip connected to the measuring object.
- ② Then the pointer deflects to the right and its deflection becomes smaller as time passes (indicating the charged charge is being discharged).
- ③ When the pointer stops at zero (∞ of the MΩ scale) and discharge has been completed, conduct the steps ⑩ and ⑪ of 6.3-4)

6.5 Measurement of ACV (AC voltage) (Measuring range is the AC 600 V range only)

⚠ WARNING

1. Do not apply a voltage exceeding the maximum rated voltage of 600 VAC.
2. During measurement, do not operate the function control knob.
3. Do not measure a voltage with the MΩ measuring switch being pressed or raised.
4. When the circuit to measure has a breaker, measure the voltage on the secondary side (load side).
5. To prevent electric shock, do not touch the metal part of the pin plug and clip.

- 1) Measuring object
Sinusoidal AC voltages (ACV) such as lighting line voltages can be measured.
- 2) Measuring method
 - ① Connect the lead with clip (black) to the earth side measuring terminal and the lead with test pin (red) to the line side measuring terminal.

- 10 -

[9] Specifications

9.1 General Specifications

AC rectifying method : Half-wave rectification
(Mean value indication rms value converted)

Meter specification : Inner-pole type tau-band system, 48 μA

Battery consumption : Checked by BATTERY CHECK range.

Allowable temperature/humidity range : 23±5 °C, 75 % RH max., no condensation.

Service temperature/humidity : 0~43 °C, 80 % RH max., no condensation.

Storage temperature/humidity : -10~50 °C, 70 % RH max., no condensation.

Service ambient condition : Altitude 2000 m max., environmental pollution II.

Power supply : Layer built type alkaline battery 6LR61(6LF22)x1(9 V)

* Factory-preinstalled battery
A battery for monitoring is preinstalled before shipping, therefore it may run down sooner than the battery life specified in the instruction manual.

The "battery for monitoring" is a battery to inspect the functions and specifications of the product.

Max. power consumption : Approx 2.6 W (at 1000 V/2000 MΩ range)

Battery life : When the lower limit measurement resistance value that can maintain the rated output voltage is measured and if one cycle for the measurement is defined as ON for 5 seconds and OFF for 25 seconds, the battery life is 500 cycles.

Degree of IP : IP20

EMC : IEC61326

Safety : IEC61010-1, IEC61010-2-030 CAT. III 600 V * IEC61010-2-033, IEC61010-031


* Measurement Category III : Line from the primary side or branch of equipment which directly takes in electricity from a distribution board to the receptacle.

Year of manufacture : The first two digits of the serial number on the bottom of this product indicate the last two digits of the year.


Size and mass : 144 (H) x 99 (W) x 43 (D) mm, approx. 310 g

- 14 -

[3] Front View and Name of Each Part

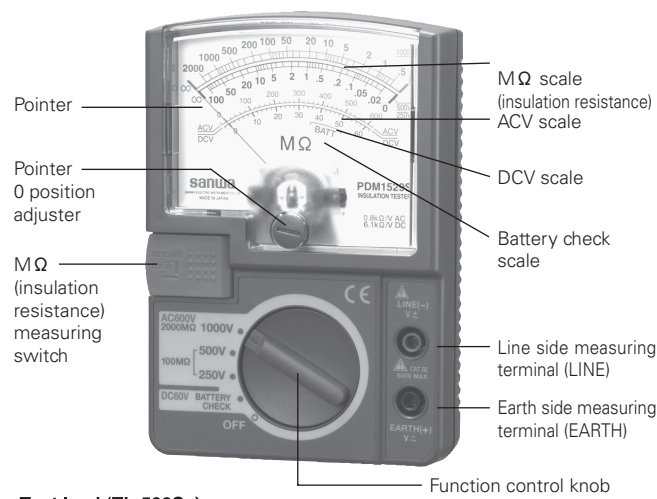

Test lead (TL-508Sa)

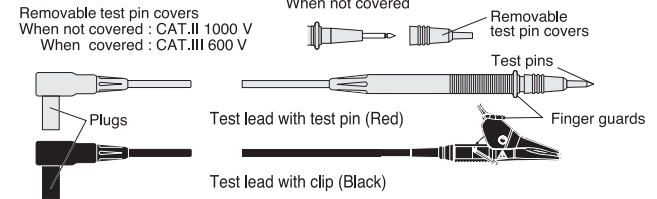

[4] Cleaning and storage

⚠ CAUTION

- The panel and the case are not resistant to volatile solvent and must not be cleaned with thinner or alcohol. For cleaning, use dry, soft cloth and wipe it lightly.
- The panel and the case are not resistant to heat. Do not place the instrument near heat-generating devices (such as a soldering iron).
- Do not store the instrument in a place where it may be subjected to vibration or from where it may fall.

- 3 -

6.3 Measurement of MΩ (Insulation Resistance)

⚠ WARNING

1. Never apply a voltage to the measuring terminal when the tester is in the MΩ measuring range.
2. Prior to measurement, disconnect the measuring object (circuit) from the power supply.
3. Prior to measurement, make sure no voltage is applied to the circuit to measure by the AC 600 V range.
4. During measurement, a high voltage is generated. Do not touch the test pin, clip and measuring object.
5. The tester and measured circuit have been charged by high voltage immediately after the measurement. Be careful not to get electric shock.
6. There is a possibility of an accident of electric shock. After the measurement, be sure to discharge the high voltage charged in the measuring object. (See 6.4 Discharge Function)

⚠ CAUTION

1. When the measuring object is grounded (earth), a normal practice is to connect the lead with clip (EARTH) to ground (earth) and the lead with test pin (LINE) to the circuit. (When this connection is used, a measurement value becomes smaller than a value obtained by the reverse connection.)
2. To prevent a measuring error, keep the test lead connected to the LINE side out of contact with the measuring object and ground (earth).
3. The insulation resistance varies largely depending on temperature and humidity. It is also influenced by a voltage to apply (measuring voltage). Normally as temperature, humidity and voltage increase, the insulation resistance decreases.

- 7 -

⚠ CAUTION

AC voltages of waveforms other than sinusoidal waveforms and frequencies other than 50 to 60 Hz will cause an indication error.

- ② Turn the function control knob to AC 600 V.
- ③ Connect the lead with clip to the earth side of the circuit to measure and the lead with test pin to the charging side (line side).
- ④ Read the indicated value on the ACV scale.
- ⑤ Disconnect the lead with test pin and the lead with clip in this order from the measuring object.
- ⑥ Turn the function control knob to the position of OFF.

6.6 Measurement of DCV (DC voltage) (Measuring range is the DV 60 V range only)

⚠ WARNING

1. Do not apply a voltage exceeding the maximum rated voltage of 60 VDC.
2. Keep in mind the warnings of 6.5 described earlier.

- 1) Measuring object
DC voltages of batteries, etc. can be measured. Also, the tester can be used to check the presence of DC voltage prior to MΩ measurement.
- 2) Measuring method
 - ① Connect the lead with clip (black) to the earth side measuring terminal and the lead with test pin (red) to the line side measuring terminal.
 - ② Turn the function control knob to DC 60 V/BATTERY CHECK.

- 11 -

Accessorie : Test lead TL508Sa, 1 set
Carrying case C-08S, 1 piece
Instruction manual, 1 copy

9.2 Measurement Range and Accuracy

Accuracy assurance : 23 °C ± 5 °C 75 % RH max.

No condensation

Attitude: Horizontal ± 5°. External magnetic field: Not present.

Battery voltage: Within the range in which the battery power is effective.

Model	PDM1529S		PDM5219S	
	Rated measuring voltage	Large numeral: 1st effective measurement scale Small numeral: 2nd effective measurement scale	Rated measuring voltage	Large numeral: 1st effective measurement scale Small numeral: 2nd effective measurement scale
MΩ (Insulation Resistance)	1000 V	0.5-2-1000	500 V	0.02-0.1-50
	2000 MΩ	-2000 MΩ	100 MΩ	-100 MΩ
	500 V	0.02-0.1-50	250 V	0.02-0.1-50
	100 MΩ	-100 MΩ	100 MΩ	-100 MΩ
ACV	250 V	0.02-0.1-50	125 V	0.02-0.1-50
	100 MΩ	-100 MΩ	100 MΩ	-100 MΩ
DCV	0-60 V			
Accuracy	• MΩ range			
	1st effective : measurement range : ± 5 % of reading			
	2nd effective : measurement range : ± 10 % of reading			
	∞ scale : ± 0.7 % of scale length			
No load voltage : ± 30 % of rated measuring voltage				
Rated current : 1-1.2 mA				
Short circuit current : max 3 mA				
• ACV range (50/60 Hz sine wave) : ± 5 % of full scale				
• DCV range : ± 5 % of full scale				
Operating instrumental uncertainty	Within ± 30 % (Maximum value tolerated by IEC standard)			
	Variation-causing factors [E1: Attitude. E2: Supply voltage. E3: Temperature]			

- 15 -